


FRESA PIANA 4T SERIE CORTA - HIGH FEED VERTICAL MILLING
MISURE DISPONIBILI : D 1 - 20



CODICE	øD	l	Bta	L	ø d
CZS 4010-0150	1	1,5	16°	50	4
CZS 4010-0250	1	2,5	16°	50	4
NEW CZS 4011-0250	1,1	2,5	16°	50	4
NEW CZS 4012-0250	1,2	2,5	16°	50	4
NEW CZS 4013-0300	1,3	3	16°	50	4
NEW CZS 4014-0300	1,4	3	16°	50	4
CZS 4015-0225	1,5	2,25	16°	50	4
CZS 4015-0400	1,5	4	16°	50	4
NEW CZS 4016-0400	1,6	4	16°	50	4
NEW CZS 4017-0400	1,7	4	16°	50	4
NEW CZS 4018-0400	1,8	4	16°	50	4
NEW CZS 4019-0400	1,9	4	16°	50	4
CZS 4020-0300	2	3	16°	50	4
CZS 4020-0600	2	6	16°	50	4
NEW CZS 4021-0600	2,1	6	16°	50	4
NEW CZS 4022-0600	2,2	6	16°	50	4
NEW CZS 4023-0600	2,3	6	16°	50	4
NEW CZS 4024-0600	2,4	6	16°	50	4
CZS 4025-0375	2,5	3,75	16°	50	4
CZS 4025-0800	2,5	8	16°	50	4
NEW CZS 4026-0800	2,6	8	16°	50	4
NEW CZS 4027-0800	2,7	8	16°	50	4
NEW CZS 4028-0800	2,8	8	16°	50	4
NEW CZS 4029-0800	2,9	8	16°	50	4
CZS 4030-0450	3	4,5	16°	60	6
CZS 4030-0800	3	8	16°	60	6
NEW CZS 4031-0800	3,1	8	16°	60	6
NEW CZS 4032-0800	3,2	8	16°	60	6
NEW CZS 4033-0800	3,3	8	16°	60	6
NEW CZS 4034-0800	3,4	8	16°	60	6
CZS 4035-1000	3,5	10	16°	60	6
NEW CZS 4036-1000	3,6	10	16°	60	6
NEW CZS 4037-1000	3,7	10	16°	60	6
NEW CZS 4038-1000	3,8	10	16°	60	6
NEW CZS 4039-1000	3,9	10	16°	60	6
CZS 4040-0600	4	6	16°	60	6

CODICE	øD	l	Bta	L	ød
CZS 4040-1100	4	11	16°	60	6
NEW CZS 4041-1100	4,1	11	16°	60	6
NEW CZS 4042-1100	4,2	11	16°	60	6
NEW CZS 4043-1100	4,3	11	16°	60	6
NEW CZS 4044-1100	4,4	11	16°	60	6
CZS 4045-1100	4,5	11	16°	60	6
NEW CZS 4046-1100	4,6	11	16°	60	6
NEW CZS 4047-1100	4,7	11	16°	60	6
NEW CZS 4048-1100	4,8	11	16°	60	6
NEW CZS 4049-1100	4,9	11	16°	60	6
CZS 4050-0750	5	7,5	16°	60	6
CZS 4050-1300	5	13	16°	60	6
NEW CZS 4051-1300	5,1	13	16°	60	6
NEW CZS 4052-1300	5,2	13	16°	60	6
NEW CZS 4053-1300	5,3	13	16°	60	6
NEW CZS 4054-1300	5,4	13	16°	60	6
CZS 4055-1300	5,5	13	16°	60	6
NEW CZS 4056-1300	5,6	13	16°	60	6
NEW CZS 4057-1300	5,7	13	16°	60	6
NEW CZS 4058-1300	5,8	13	16°	60	6
NEW CZS 4059-1300	5,9	13	16°	60	6
CZS 4060-0900	6	9	-	60	6
CZS 4060-1300	6	13	-	60	6
CZS 4060-1800	6	18	-	60	6
CZS 4065-1600	6,5	16	16°	70	8
CZS 4070-1050	7	10,5	16°	70	8
CZS 4070-1600	7	16	16°	70	8
CZS 4070-2100	7	21	16°	70	8
CZS 4075-1600	7,5	16	16°	70	8
CZS 4080-1200	8	12	-	70	8
CZS 4080-1900	8	19	-	70	8
CZS 4080-2400	8	24	-	70	8
CZS 4085-1900	8,5	19	16°	80	10
CZS 4090-1350	9	13,5	16°	80	10
CZS 4090-1900	9	19	16°	80	10
CZS 4090-2700	9	27	16°	80	10
CZS 4095-1900	9,5	19	16°	80	10
CZS 4100-1500	10	15	-	80	10
CZS 4100-2200	10	22	-	80	10
CZS 4100-3000	10	30	-	80	10
CZS 4105-2200	10,5	22	16°	100	12
CZS 4110-1650	11	16,5	16°	100	12
CZS 4110-2200	11	22	16°	100	12
CZS 4110-3300	11	33	16°	100	12
CZS 4115-2200	11,5	22	16°	100	12
CZS 4120-1800	12	18	-	100	12
CZS 4120-2600	12	26	-	100	12
CZS 4120-3600	12	36	-	100	12
CZS 4130-2600	13	26	-	110	12
CZS 4160-2400	16	24	-	110	16
CZS 4160-3200	16	32	-	110	16
CZS 4200-3000	20	30	-	125	20
CZS 4200-4000	20	40	-	125	20

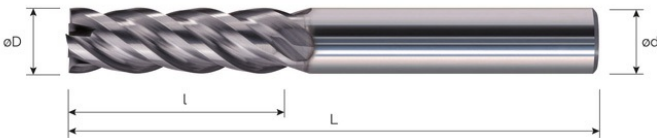